JULY 1895
MAYSVILLE
KY.

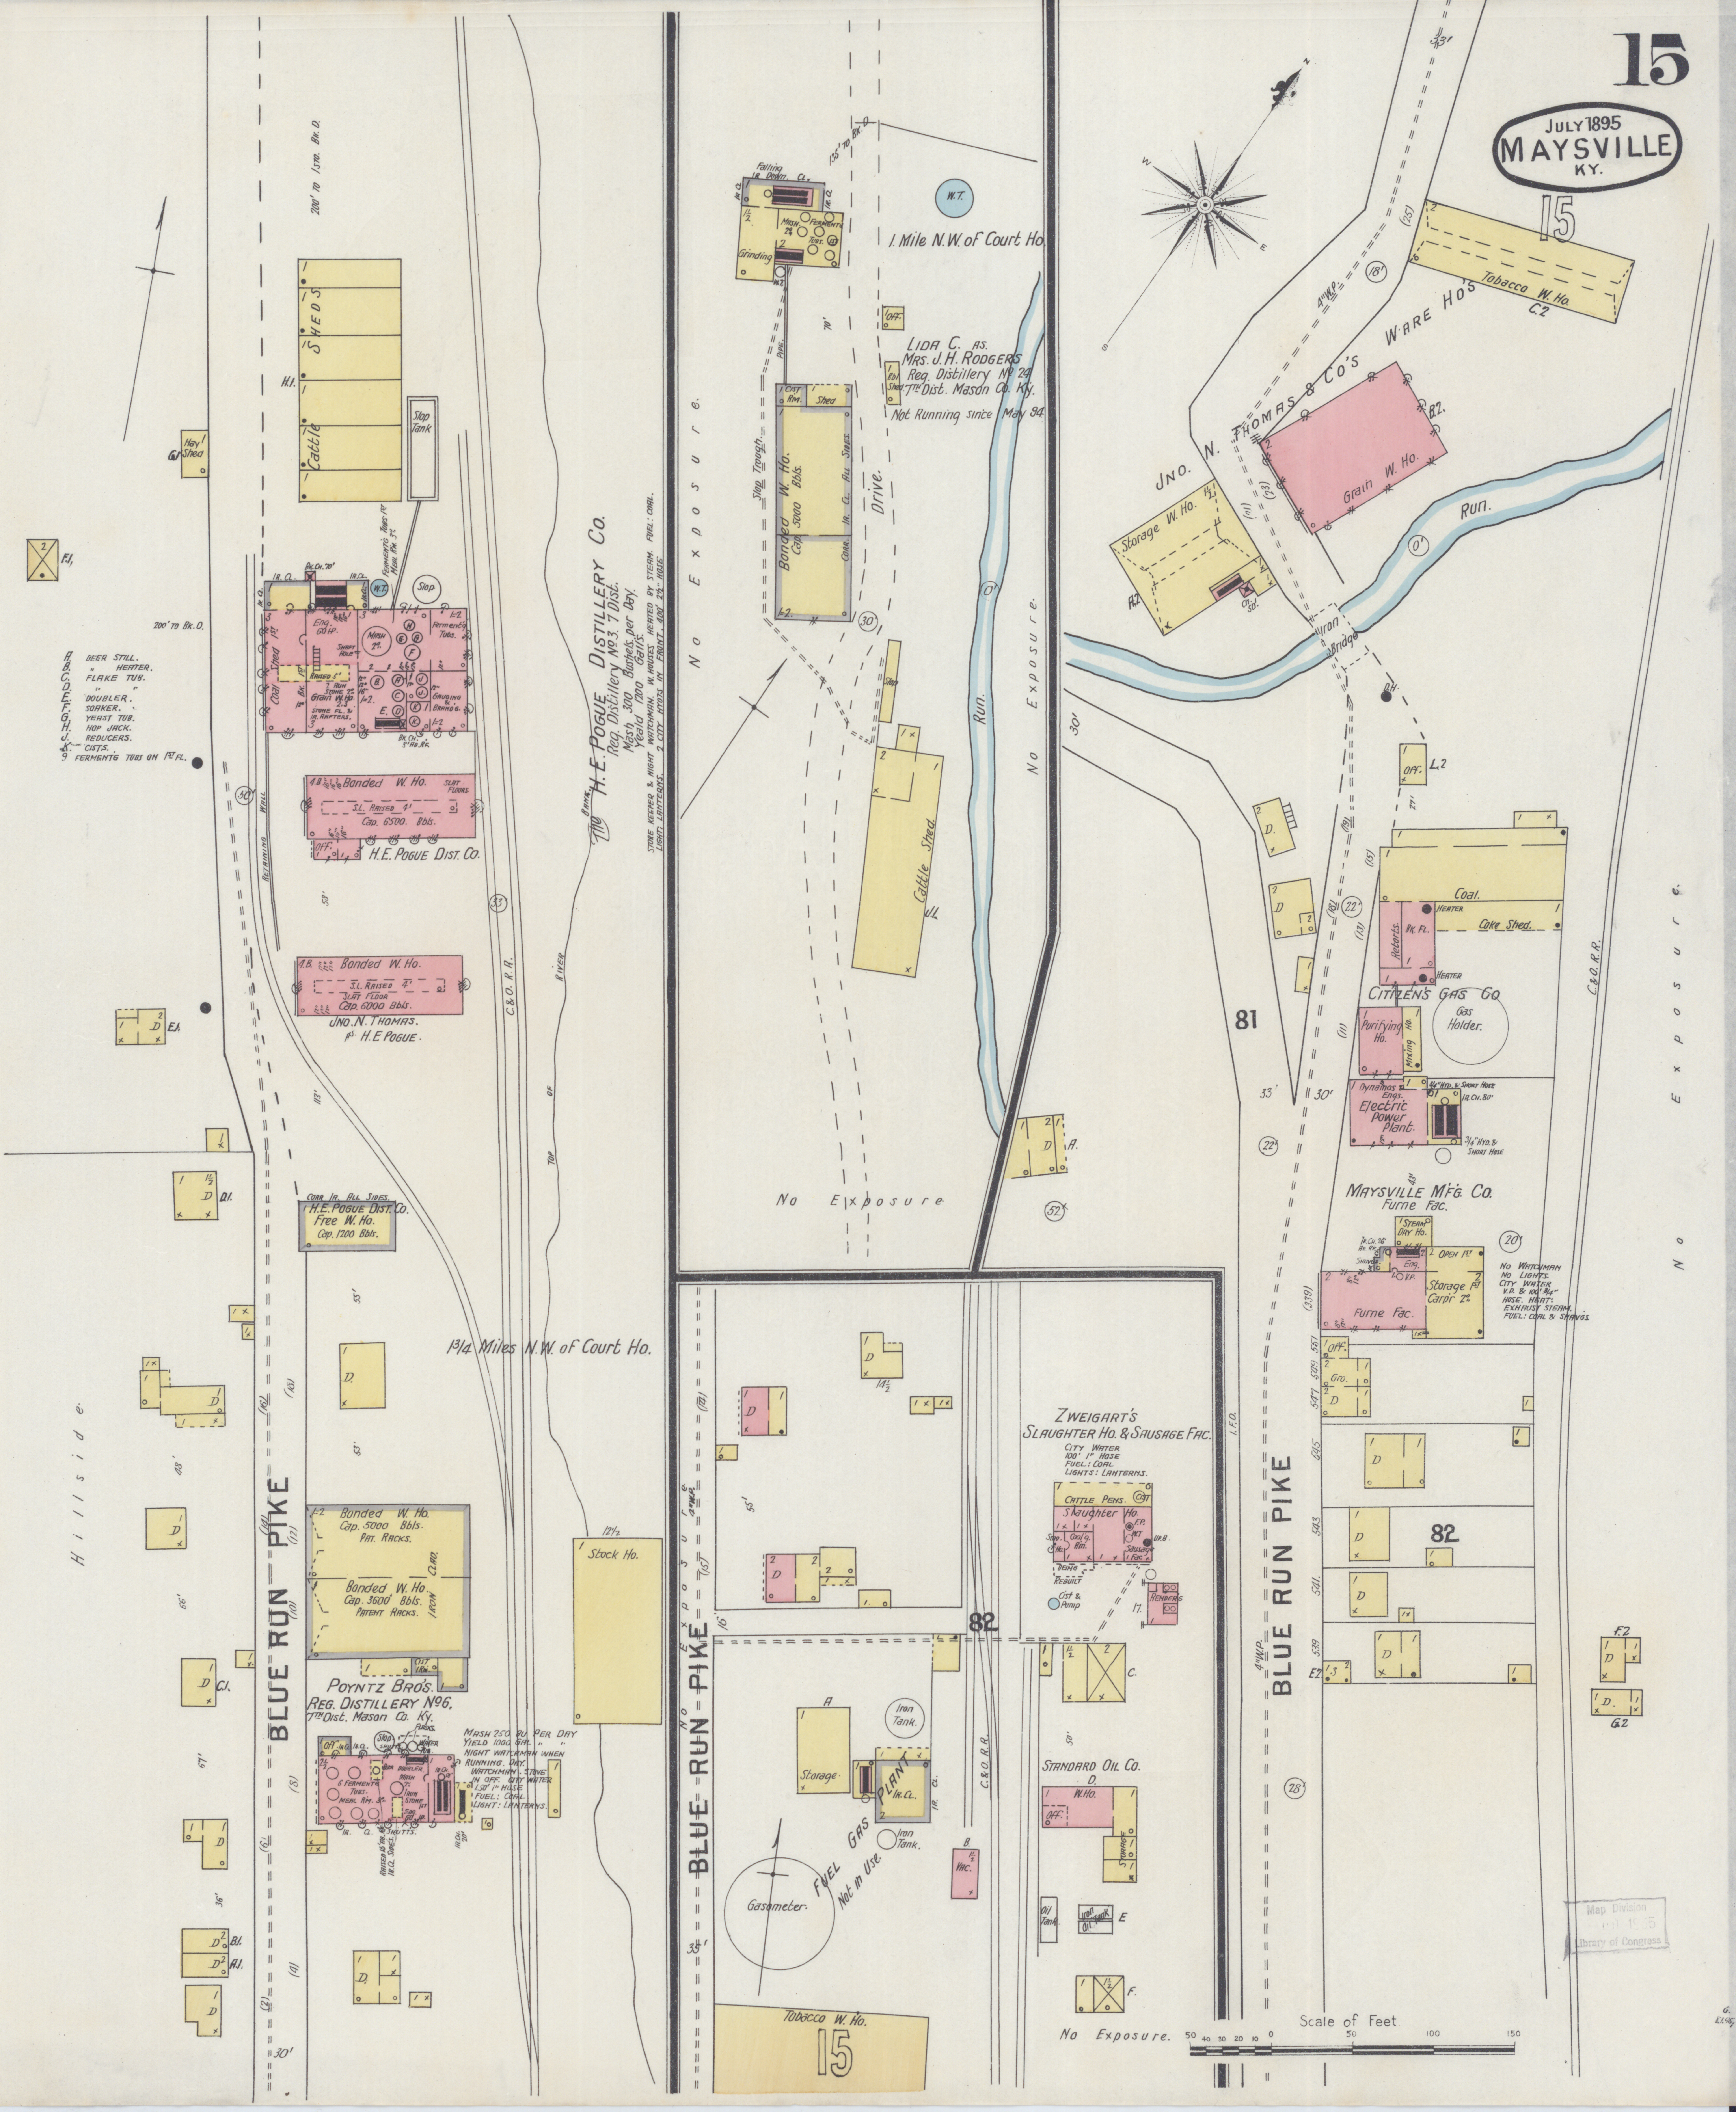

200' TO 1ST. BK. D.
Cattle SHEDS
H.1.
Hay Shed
G1
Slop Tank
F1.
BK. CH. 70'
IR. CL.
W.T.
Slop
Fermentg Tubs 1st Meal Rm. 3rd
200' TO BK. D.
A. BEER STILL.
B. " HEATER.
C. FLAKE TUB.
D. " "
E. DOUBLER.
F. SOAKER.
G. YEAST TUB.
H. HOP JACK.
J. REDUCERS.
K. CISTS.
9 FERMENTG TUBS ON 1ST FL.
Coal Shed 1st
Eng. 60 H.P.
Shaft Hole
Mash 2d.
Fermentg Tubs.
Raised 5'
2 Run Stone 2d. Grain W. Ho. 2.3
Stone Fl. & Ir. Rafters.
Gauging & Brandg.
BK. CH. 8' AB. RF.
Retaining Wall
50'
4.B. Bonded W. Ho. Slat Floors.
S.L. Raised 4'
Cap. 6500. Bbls.
Off.
H.E. POGUE DIST. CO.
53'
4.B. Bonded W. Ho.
S.L. Raised 4'
Slat Floor
Cap. 6000 Bbls.
JNO. N. THOMAS.
AS H.E. POGUE.
E1.
113'
33'
C.&O. R.R.
Top of River Bank
The H.E. POGUE DISTILLERY CO.
Reg. Distillery No. 3. 7 Dist.
Mash 300 Bushels per Day.
Yeald 1200 Galls.
Store keeper & night watchman. W. houses heated by steam. Fuel: coal. Light: lanterns. 2 city hydts in front. 400' 2½" hose.
D1.
Corr. Ir. All Sides.
H.E. POGUE DIST. CO.
Free W. Ho.
Cap. 1200 Bbls.
55'
13/4 Miles N.W. of Court Ho.
Hillside
48'
(16)
(18)
(14)
(12)
(10)
(8)
(6)
(4)
(2)
53'
D.
Bonded W. Ho.
Cap. 5000 Bbls.
Pat. Racks.
Bonded W. Ho.
Cap. 3600 Bbls.
Patent Racks.
Iron Clad.
Cist. Rm.
66'
67'
36'
C1.
B1.
A1.
30'
BLUE RUN PIKE
POYNTZ BRO'S.
REG. DISTILLERY NO. 6,
7TH DIST. MASON CO. KY.
Slop
Flasks.
Water Tub.
Shutts.
6 Fermentg Tubs.
Meal Rm. 3d.
Beer
Doubler
Mash 2d.
1 Run Stone 1st
Eng. 50 H.P.
Raised 15' Ab. Rf. Ir. Cl. Sides.
Ir. Ch. 20'
Mash 250 Bu. Per Day
Yield 1000 Gal. " "
Night watchman when running. Day watchman. Stove in off. City water 150' 1" hose.
Fuel: coal.
Light: lanterns.
12½
Stock Ho.
Falling Down. Cl.
Ir. Cl.
Mash 2d.
Fermentg Tubs. 1st
Grinding
W.T.
135' to Bk. D.
Pipe.
70'
Slop Trough
Cist. Rm.
Shed
Bonded W. Ho.
Cap. 5000 Bbls.
Ir. Cl. All Sides.
Corr.
30'
Drive.
W.T.
1. Mile N.W. of Court Ho.
Off.
Bbl. Shed
LIDA C. AS.
MRS. J.H. RODGERS
Reg. Distillery No. 24.
7th Dist. Mason Co. Ky.
Not Running since May 94.
No Exposure.
Slop
Cattle Shed.
J1.
Run.
0'
No Exposure.
A.
52'
No Exposure
D
14½
(174)
(15)
(5)
55'
No Exposure
BLUE RUN PIKE
82
A
Storage
Iron Tank.
FUEL GAS PLANT
Not in Use.
Ir. Cl.
Iron Tank.
Gasometer.
35'
Tobacco W. Ho.
15
B.
Vac.
C.&O. R.R.
ZWEIGART'S
SLAUGHTER HO. & SAUSAGE FAC.
City water
100' 1" hose
Fuel: coal
Lights: lanterns.
Cattle Pens.
Cist.
Slaughter Ho.
Smo. Ho.
Coal'g Rm.
F.P.
W.T.
Sausage Fac.
Up. B.
Being Rebuilt
Cist & Pump
Renderg
17.
C.
50'
STANDARD OIL CO.
D.
W. Ho.
Off.
Storage
Oil Tank.
Iron Oil Tank
E
F.
No Exposure.
Scale of Feet
50 40 30 20 10 0 50 100 150
I.F.D.
4" W.P.
BLUE RUN PIKE
28'
33'
18'
(25)
4" W.P.
JNO. N. THOMAS & CO'S WARE HO'S
Tobacco W. Ho.
C2
15
Grain W. Ho.
B2.
Storage W. Ho.
A2
Ch. 50'
(11)
(13)
Run.
0'
Iron Bridge
O.H.
30'
Off.
L2
27'
D.
(19)
(15)
(18)
22'
(13)
(11)
81
Coal.
Heater
Cake Shed.
Retorts.
Bk. Fl.
Heater
CITIZEN'S GAS CO
Purifying Ho.
Mixing Ho.
Gas Holder.
33'
30'
Dynamos & Engs.
Electric Power Plant.
3/4" Hyd. & Short Hose
Ir. Ch. 80'
3/4" Hyd. & Short Hose
22'
43'
MAYSVILLE M'F'G. CO.
Furne Fac.
Steam Dry Ho.
Ir. Ch. 26' Ab. Rf.
Shavgs.
Eng.
V.P.
Open 1st
Storage 1st
Carpr 2d.
20'
No watchman
No lights.
City water
V.P. & 100' 3/4" hose. Heat: exhaust steam.
Fuel: coal & shavgs.
(339)
Furne Fac.
551
549
547
545
543
541
539
Off.
Gro.
D
82
E2
F2
G2
C.&O. R.R.
No Exposure.

Map Division
1895
Library of Congress